


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-245	Smoke	8/25/2009	ADS/TM	S2100_013MH	Dry	Yes	508.98

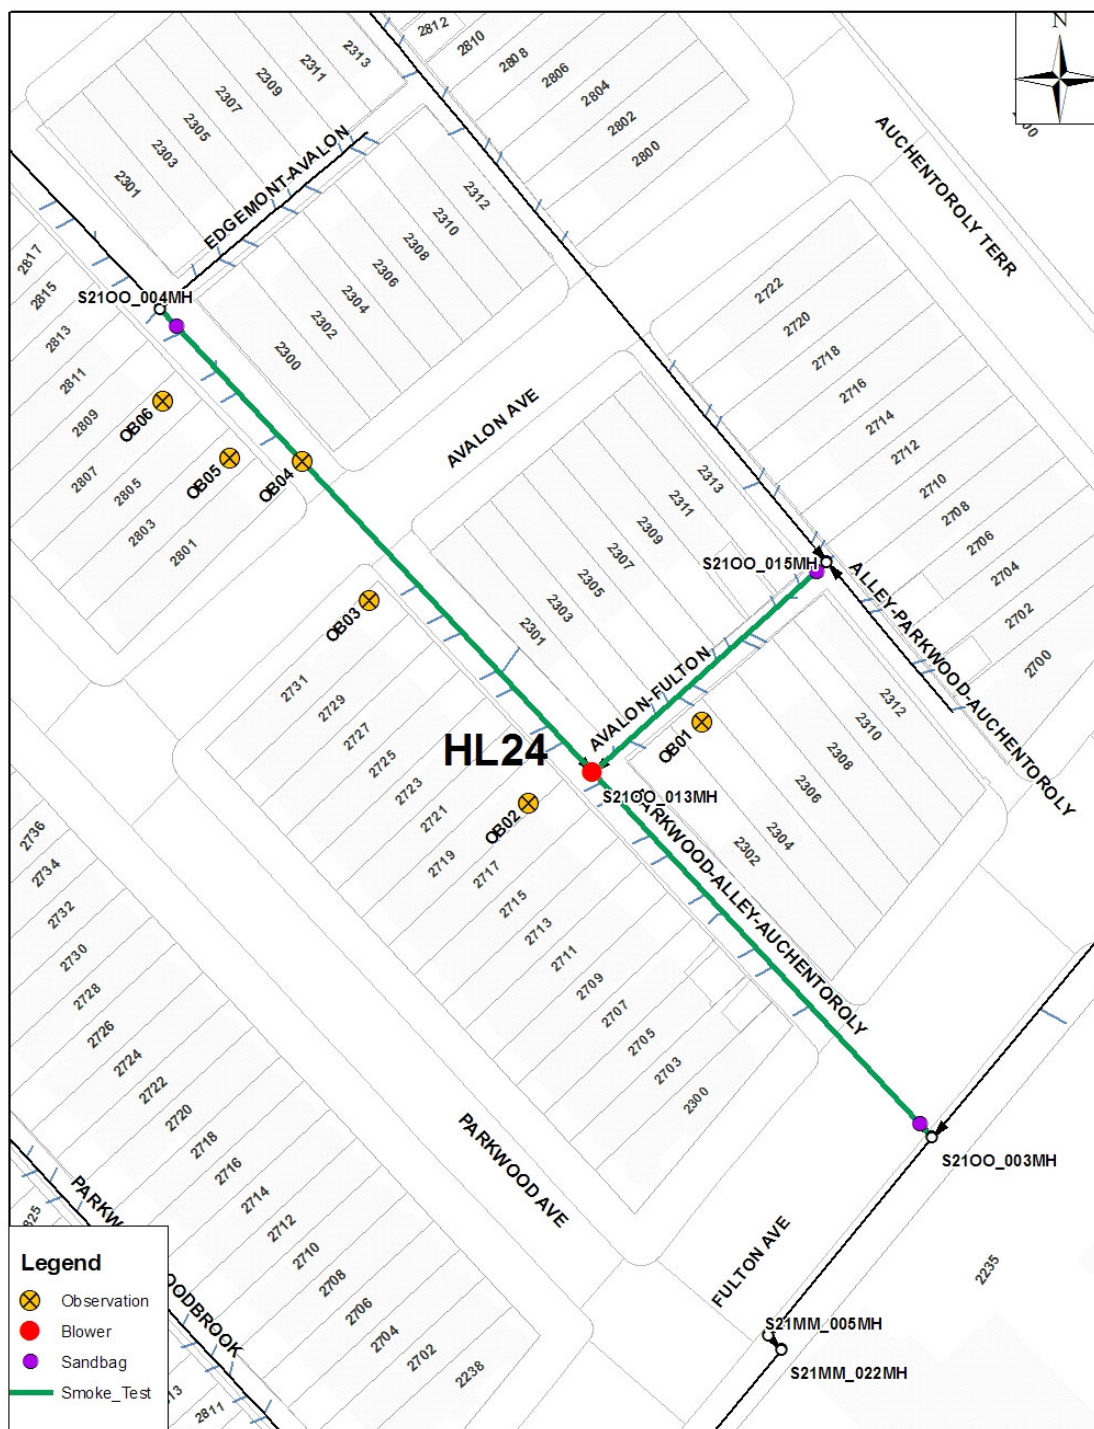

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-245	Smoke	8/25/2009	ADS/TM	S2100_013MH	Dry	Yes	508.98

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S2100_015G1	S2100_015MH	S2100_013MH	110.644	8
S2100_013G1	S2100_013MH	S2100_003MH	175.186	8
S2100_004G1	S2100_004MH	S2100_013MH	223.154	8

Observations & Photos

Obs_ID S1028-245-OB01

Address 2304 Fulton Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S2100_013MH

Comments Smoke from service lateral in back yard. 2304 Fulton Ave.



Picture \S1028-245-OB01-P01.jpg

Comments Back of house, 2304 Fulton Ave.

Obs_ID S1028-245-OB02

Address 2719 Parkwood Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S2100_013MH

Comments Smoke from service lateral in back yard. 2719 Parkwood Ave.



Picture \S1028-245-OB02-P01.jpg

Comments Back of house, 2719 Parkwood Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-245	Smoke	8/25/2009	ADS/TM	S2100_013MH	Dry	Yes	508.98

Obs_ID S1028-245-OB03

Address 2731 Parkwood Ave

Status Private

Source Service Lateral

Location Paved concrete

Nearest MH S2100_013MH

Comments Smoke from service lateral in paved concrete behind house. 2731 Parkwood Ave.



Picture \S1028-245-OB03-P01.jpg

Comments Back of house, 2731 Parkwood Ave.

Obs_ID S1028-245-OB05

Address 2803 Parkwood Ave

Status Private

Source Service Lateral

Location Yard - back

Nearest MH S2100_004MH

Comments Smoke from service lateral along fence in back yard. 2803 Parkwood Ave.



Picture \S1028-245-OB05-P01.jpg

Comments Back of house, 2803 Parkwood Ave.

Obs_ID S1028-245-OB04

Address 2801 Parkwood Ave


Status Public

Source Catch Basin

Location Alley

Nearest MH S2100_004MH

Comments Smoke from catch basin in alley behind 2801 Parkwood Ave.

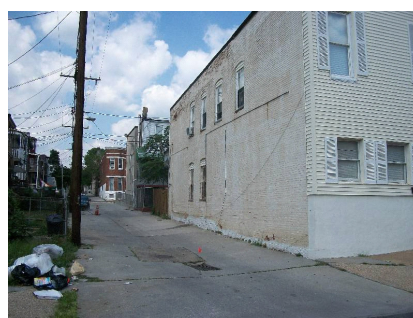

Picture \S1028-245-OB04-P01.jpg

Comments Alley behind 2801 Parkwood Ave. looking northwest

Obs_ID S1028-245-OB06

Address 2807 Parkwood Ave

Status Private

Source Cleanout

Location Yard - back

Nearest MH S2100_004MH

Comments Smoke from above-grade cleanout in back yard. 2807 Parkwood Ave.



Picture \S1028-245-OB06-P01.jpg

Comments Back of house, 2807 Parkwood Ave.